



ILA200260A

2000 - 2600 MHz LOW NOISE AMPLIFIER

REV A
August 2016

Key Features



- 50 Ohm Impedance
- 2.0 ~ 2.6 GHz
- 0.65 dB Noise Figure
- 26 dB Gain
- 1.3:1 VSWR
- 12.0 dBm P_{1dB}
- Precision Machined Housing
- Single DC Power Supply

Applications

- PCS, 3G, WiMAX
- Fixed Wireless
- Measurement
- Mobile Infrastructures



Absolute Maximum Ratings

Parameters	Units	Ratings
DC Power Supply Voltage	V	-0.5,+32
RF Input CW Power	dBm	10
Storage Temperature	°C	-40 ~ +85
Operating Temperature	°C	-40 ~ +85


Operation of this device beyond any one of these parameters may cause permanent damage.

Specifications


Summary of the key electrical specifications at 25°C

Index	Testing Item	Symbol	Test Constraints	Min	Nom	Max	Unit
1	Frequency Range	BW	50 Ohm Impedance	2000		2600	MHz
2	Gain	S ₂₁	2000 – 2600 MHz	24	26	28	dB
3	Gain Variation	ΔG	2000 – 2600 MHz		+/- 0.8		dB
4	VSWR	SWR _i	2000 – 2600 MHz all RF ports		1.3:1	1.5:1	Ratio
5	Reverse Isolation	S ₁₂	2000 – 2600 MHz		37		dB
6	Noise Figure	NF	2000 – 2600 MHz		0.65	0.9	dB
7	Output Power 1dB Compression Point	P _{1dB}	2000 – 2600 MHz	8	12		dBm
8	Output-Third-Order Interception Point	IP ₃	Two-Tone, P _{out} = 0 dBm each, 1 MHz Separation	20	23		dBm
9	Current Consumption	I _{dd}	V _{dd} = +12.0 V		55		mA
10	Power Supply Operating Voltage	V _{dd}		+7	+12	+16	V
11	Operating Temperature	T _o		-40		+85	°C
12	Thermal Resistance	R _{th,c}	Junction to case			215	°C/W

Functional Block Diagram

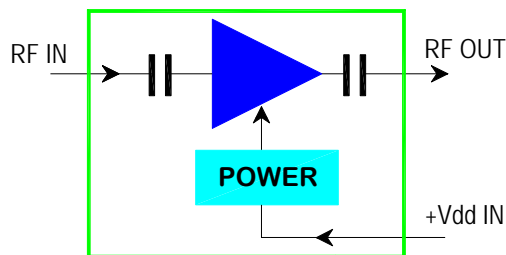

Outline, IP-3 Housing

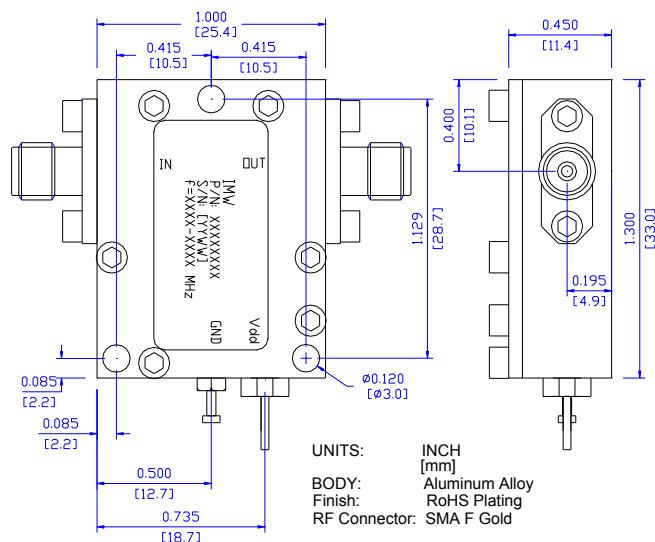





Ordering Information

Model Number	Connectors	
	IN	OUT
ILA200260A	SMA Female	SMA Female

Specifications and information are subject to change without notice.



Typical Data

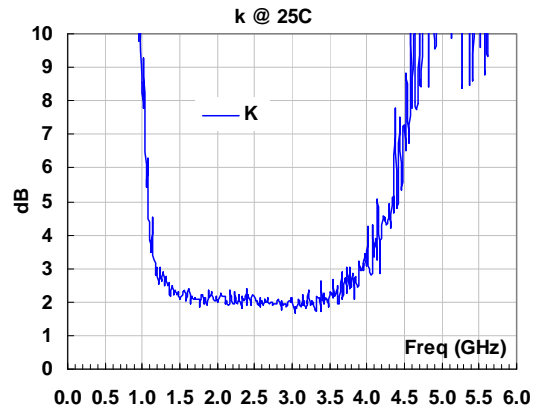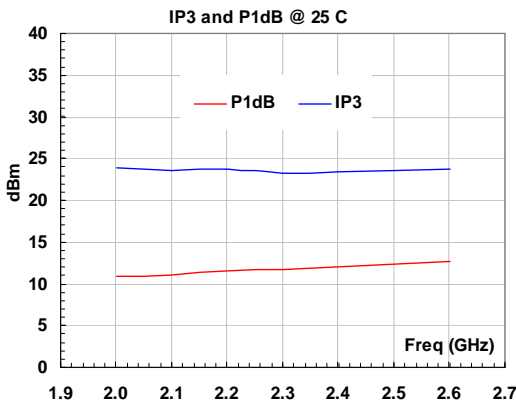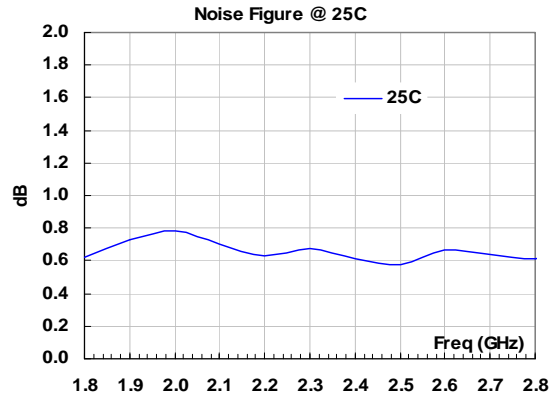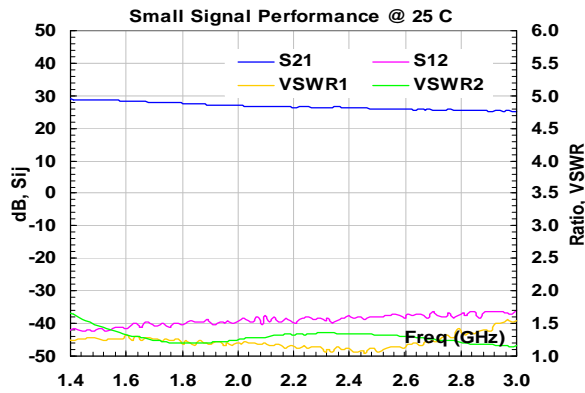

Application Notes:

A. SMA Torque Wrench Selection

Always use a torque wrench with 5 ~ 6 inch-lb coupling torque setting for mating the SMA cables to the amplifier. Never use torque more than 8 inch-lb wrench for tightening the mating cable to the connector. Otherwise, the permanent damage will occur to the SMA connectors of the amplifier. 8710-1582 (5 inch-lb) is one of the ideal torque wrench choice from Agilent Technology.

B. Mounting the Amplifier

Use three pieces of #2-56 with longer than 9/16" screws for mounting the amplifier on a metal-based chase. Flat and spring washers are needed to prevent the screw loosening during the shock and vibration. Always use the appropriate torque setting of the power screwdriver to mount them.
