



ILA100450L

1000 - 4200 MHz LOW NOISE LIMITER AMPLIFIER

REV A
August 2016

Key Features

- 50 Ohm Impedance
- 1.0 ~ 4.2 GHz
- 1.25 dB Noise Figure
- 26 dB Gain
- 1.5:1 VSWR
- 30.0 dBm Max P_{IN}
- Precision Machined Housing
- Single DC Power Supply



Applications

- GPS, DCS, PCS, 3G
- S-band and C-band
- Receiver Amplifiers
- Mobile Infrastructures



Absolute Maximum Ratings

Parameters	Units	Ratings
DC Power Supply Voltage	V	-0.5,+32
RF Input CW Power	dBm	30
Storage Temperature	°C	-40 ~ +85
Operating Temperature	°C	-40 ~ +85


Operation of this device beyond any one of these parameters may cause permanent damage.

Specifications


Summary of the key electrical specifications at 25°C

Index	Testing Item	Symbol	Test Constraints	Min	Nom	Max	Unit
1	Frequency Range	BW	50 Ohm Impedance	1000		4200	MHz
2	Gain	S ₂₁	1000 – 4000 MHz	24.5	26	28.5	dB
3	Gain Variation	ΔG	1000 – 4000 MHz		+/- 1.0		dB
4	Input VSWR	SWR ₁	1000 – 4000 MHz		1.5:1	1.8:1	Ratio
5	Output VSWR	SWR ₂	1000 – 4000 MHz		1.4:1	1.7:1	Ratio
6	Reverse Isolation	S ₁₂	1000 – 4000 MHz		45		dB
7	Noise Figure	NF	1000 – 4000 MHz		1.25	1.7	dB
8	Output Power 1dB Compression Point	P _{1dB}	1000 – 4000 MHz	12	15		dBm
9	Output-Third-Order Interception Point	IP ₃	Two-Tone, P _{out} = 0 dBm each, 1 MHz Separation	24	26		dBm
10	Current Consumption	I _{dd}	V _{dd} = +12.0 V		50		mA
11	Power Supply Operating Voltage	V _{dd}		+7	+12	+16	V
12	Operating Temperature	T _o		-40		+85	°C
13	Thermal Resistance	R _{th,c}	Junction to case			215	°C/W

Functional Block Diagram

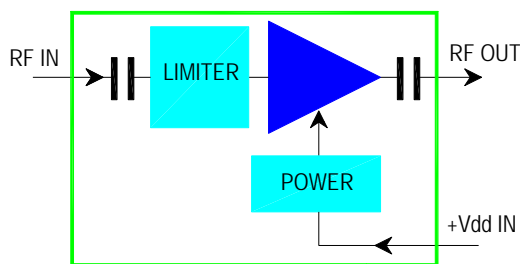

Outline, IP-3 Housing

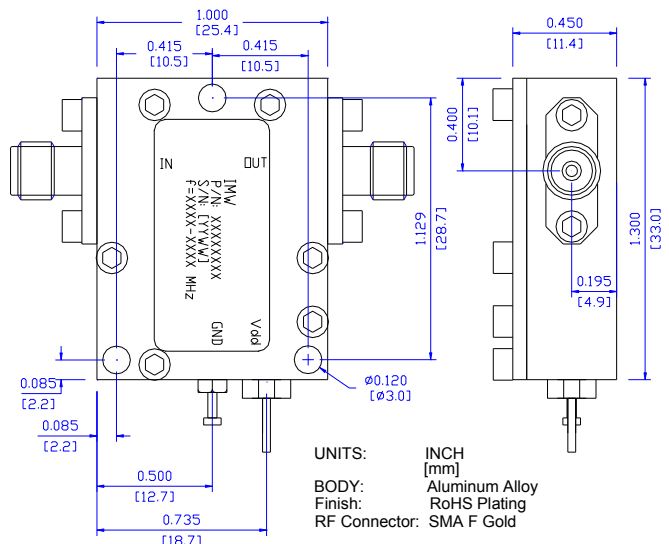





Ordering Information

Model Number	Connectors	
	IN	OUT
ILA100450L	SMA Female	SMA Female

Specifications and information are subject to change without notice.



Typical Data

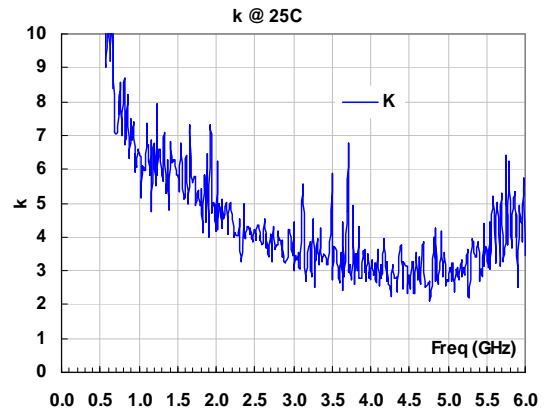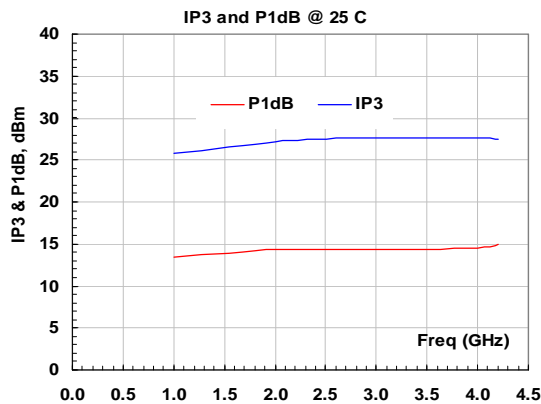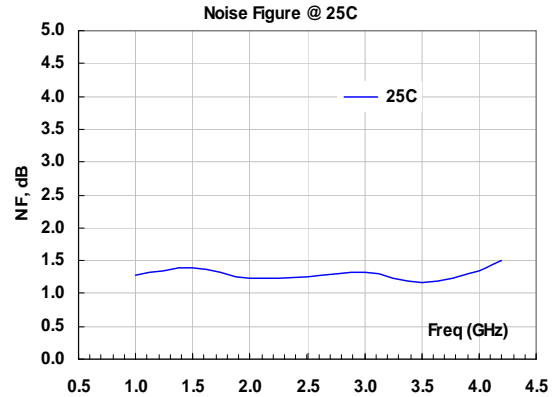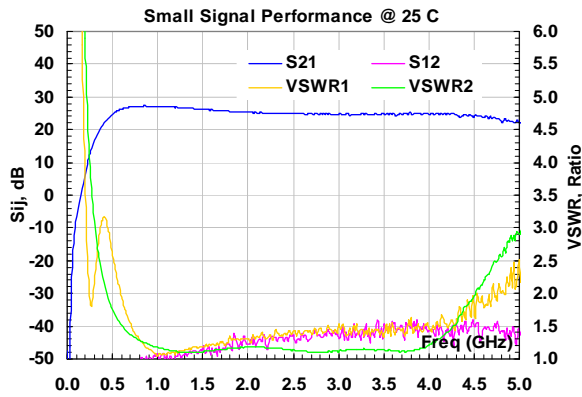

Application Notes:

A. SMA Torque Wrench Selection

Always use a torque wrench with 5 ~ 6 inch-lb coupling torque setting for mating the SMA cables to the amplifier. Never use torque more than 8 inch-lb wrench for tightening the mating cable to the connector. Otherwise, the permanent damage will occur to the SMA connectors of the amplifier. 8710-1582 (5 inch-lb) is one of the ideal torque wrench choice from Agilent Technology.

B. Mounting the Amplifier

Use three pieces of #2-56 with longer than 9/16" screws for mounting the amplifier on a metal-based chase. Flat and spring washers are needed to prevent the screw loosening during the shock and vibration. Always use the appropriate torque setting of the power screwdriver to mount them.
